



20. Solder the below red wire from Turret board to the Pin7 of GZ34 as below:

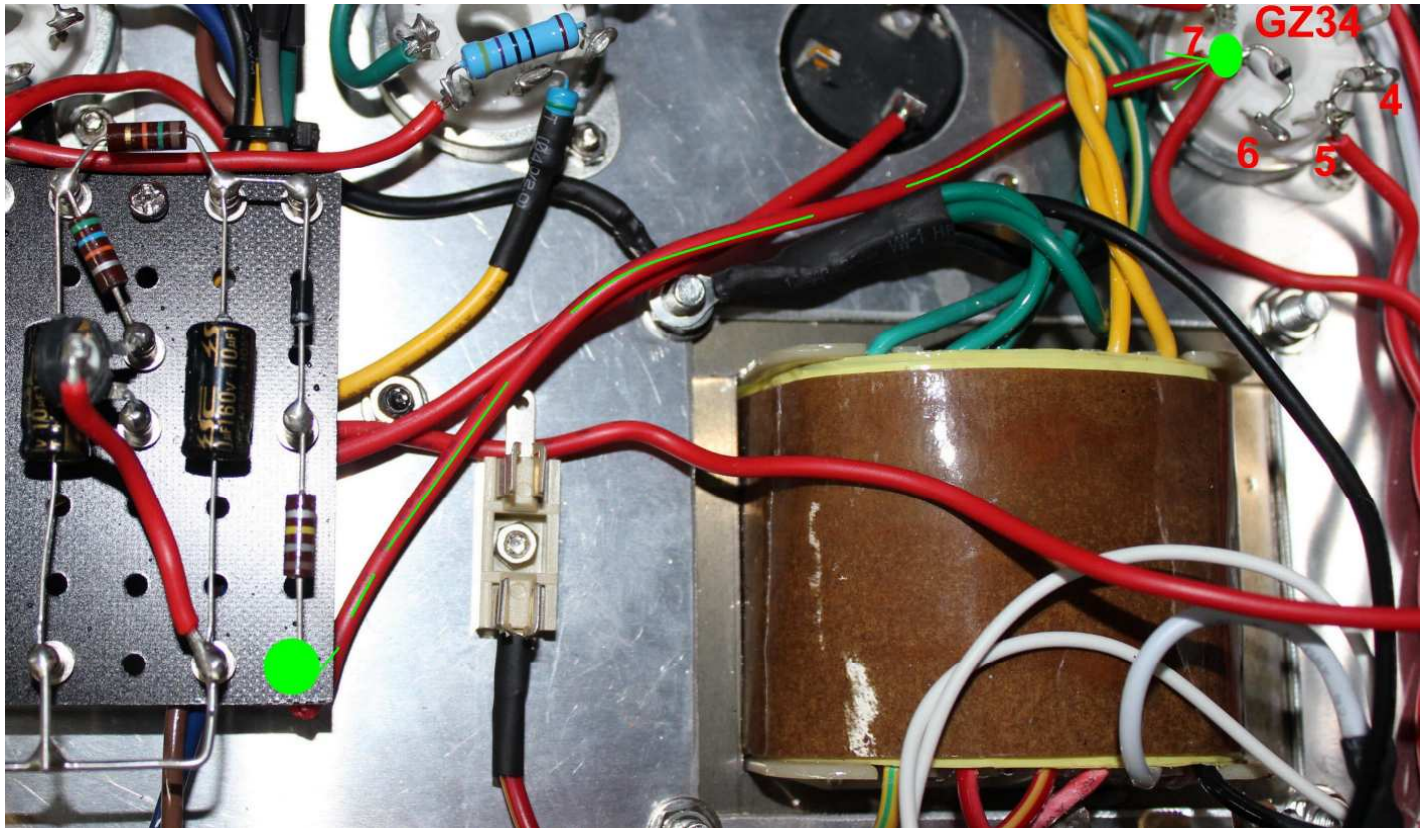

21. Solder two black wires and the yellow/green wire from PT together to a Grounding Lug and lock it onto the grounding screw as follow:

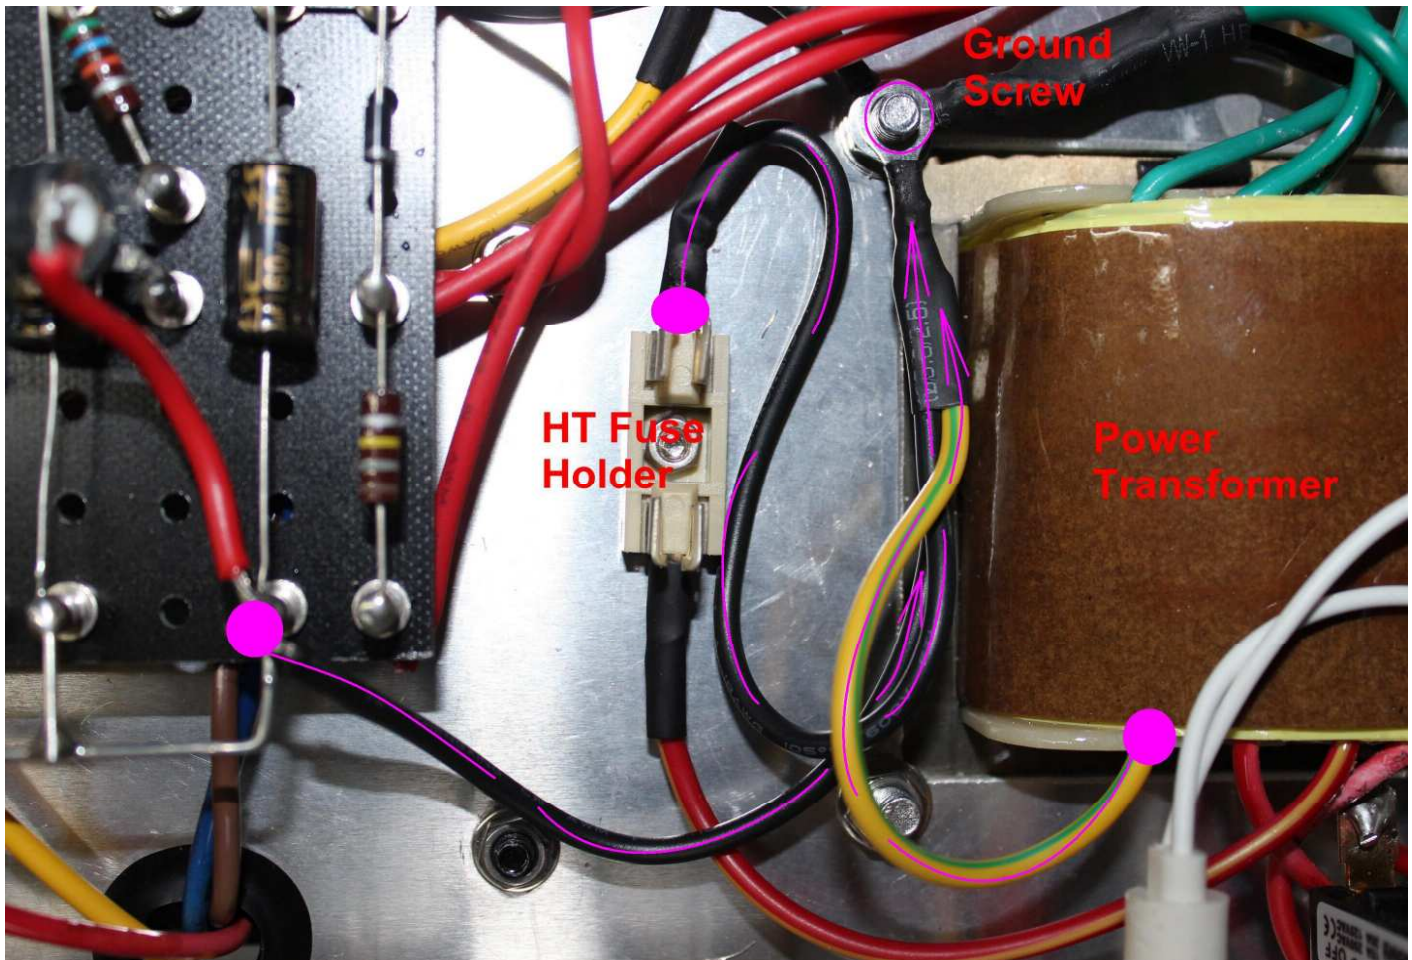


22. Input Jacks wirings:

\*Use solid wire jumpers to connect Pin1, Pin4, Pin5, Pin9, Pin12 and Pin13 together as below green line;

\*Use a solid wire jumper to connect Pin2 to Pin8; See purple line below

\*Use a solid wire jumper to connect Pin10 to Pin16; See purple line below

\*Solder a 1M resistor across Pin1 and Pin2; Solder another 1M resistor across Pin9 and Pin10;

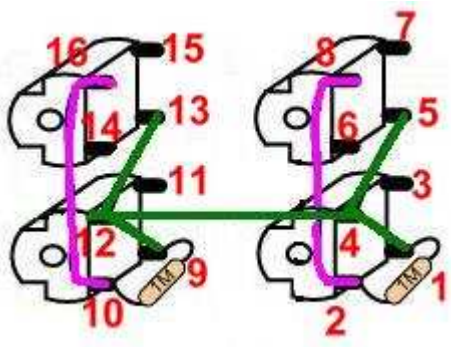

23. Turret board to Input Jacks:

